

CALIBRATION FOR PWII

1. Make sure the scale is off. Under the platter on the left side in the front is a hole covered with a rubber plug. Remove the plug. Inside the hole is the calibration switch.
2. With a nonmetallic tool press and hold the calibration switch and then press the “**ON/OFF**” key.
3. The display will do a self test then alternately flash the version number and “**CAL**” three times and then will show “**C-0**”.
4. The “**TARE**” key advances through the “**C**” settings upward while the “**UNIT**” key will go down.
5. Use the “**TARE**” key to advance to “**C-3**” and then press the “**ZERO**” key. The display will show “**ULOAD**”.
6. With the platter on the scale and no weight on the platter press the “**ZERO**” key. The display will show A/D counts, “**StabL**”, and then “**LOAD**”.
7. Put the full capacity of weight on the platter and press the “**ZERO**” key. The display will show A/D counts, “**StabL**”, and then go back to “**C-3**”.
8. Take the weight off the scale and press the “**UNIT**” key to go back to “**C-0**”. Press the “**ZERO**” key. The display will do a self test then count up and go into the weigh mode.